

# Manhole Inspection Summary

Manhole # S25QQ1013MH

Printed On: 12/17/2008

Page 1 of 3

**Inspection** ☐ Is Incomplete Rating: **5) Immediate Attention Required**

Record Plat: **25QQ1** Node: **013** Status: **Found**

Insp Date: **12/28/06 12:44 PM**

Incomplete Comments

Crew: **WM, BC**  
Inspector: **Creary, B**  
Firm: **RKK**

**Location** Address: **4711 ROLAND AVE**

Cross Street: **CLUB RD**

**Manhole** Type: **Inline** Location: **Grass**

Ground Conditions: **Dry**

☐ Prev. Rehab

Weather: **Dry**

Subject To Ponding: **None**

Comments

**Cover** Shape: **Circular** Diameter: **17** (in.) Length: (in.) Dist A/B Grade: **0** (in.)

Type: **Sanitary**

Condition: **Sound**

Cover Material: **Cast Iron**

Properties: ☐ Bolted ☐ Vented ☐ Water Tight ☐ Water Tight Insert

**Frame** Offset: **0** (in.) Condition: ☒ Sound ☐ Cracked ☐ Leaks

**Chimney / Frame Adjustment** ☒ Exists Material: **Brick** ☐ Parged Height: **12** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☒ **Deteriorated**

Infiltration: ☐ None ☒ **Joint** ☐ Cracks ☐ Mortar ☒ **Roots** ☒ **Wall**

**Corbel** Material: **Brick** ☐ Parged Type: **Concentric/Eccentric**

Condition: ☒ Sound ☐ Cracked ☐ Root Intrusion ☐ Loose Brick ☐ Deteriorated

Infiltration: ☒ None ☐ Joint ☐ Cracks ☐ Mortar ☐ Roots ☐ Wall

**Barrel** Material: **Brick** ☐ Parged

Shape: **Rectangular** Diameter: **24** (in.) Length: **60** (in.)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Loose Brick ☐ Deteriorated

Infiltration: ☐ None ☐ Joint ☐ Cracks ☐ Mortar ☒ **Roots** ☒ **Wall**

**Bench** ☒ Exists Material: **Brick** ☐ Parged ☒ **Debris** (not Condition related)

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Deteriorated ☐ Leaks ☐ Debris

**Channel** Material: **Brick** ☐ Parged ☐ Debris (not Condition related)

Channel Exposure: **Fully Open** Junc Dist: **0** nearest .5 ft. Azimuth:

Condition: ☐ Sound ☐ Cracked ☒ **Root Intrusion** ☐ Deteriorated ☐ Leaks ☒ **Debris**

**Steps** Count: **3** Missing: **0** ☒ **Corroded**

**Surcharge** ☒ **Evidence Of Surcharge** Depth: **1** (ft.) ☐ Active Surcharge Present

# Manhole Inspection Summary

Manhole # S25QQ1013MH

Printed On: 12/17/2008

Page 2 of 3

Location View



Top View




Adjustment and Barrel root intrusion and infiltration. Corroded steps. Evidence of surcharge - Bench debris. Channel

Defect



Adjustment deterioration, root intrusion and infiltration. Corbel and Barrel infiltration.

Defect

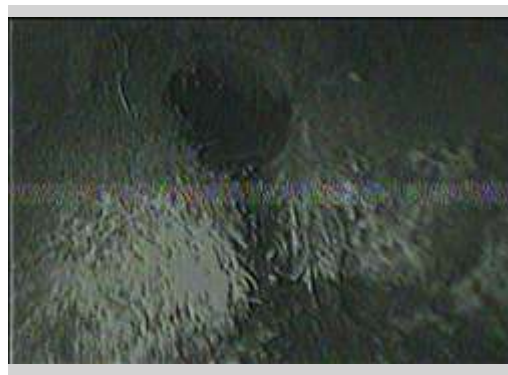

Bench and Channel root intrusion.

## Manhole Inspection Summary

Manhole # S25QQ1013MH

Printed On: 12/17/2008

Page 3 of 3

### 6 in. Circular Gravity Sewer Pipe Out @ 12 O'Clock



Barrel deterioration, root intrusion and infiltration.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.49** (ft.) Flow Characteristics: **Slow**

Deposits: ☐ None ☒ Mud ☐ Sludge ☒ Debris ☒ Grease

Silt Depth: **3** (in.) Deposits Extent: **Heavy**

Infiltration: **None** Pipe Seal Cond: **Unknown**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection

### 6 in. Circular Gravity Sewer Pipe In @ 6 O'Clock



Bench and Channel root intrusion.

Rod and Bar (Angled)

Pipe Material: **Clay** ☐ Pipe Lined

Invert Depth: **8.46** (ft.) Flow Characteristics: **Slow**

Deposits: ☒ None ☐ Mud ☐ Sludge ☐ Debris ☐ Grease

Silt Depth: (in.) Deposits Extent:

Infiltration: **Evidence** Pipe Seal Cond: **Roots**

Drop: **None**

Connects To: **Manhole**

☐ Possible Illicit Connection